


Evaluation Tracked Excavator		www.mevas.net	
Customer/location:	Prima Equipment/Hardenberg	vers 02-22	
Date:	28.06.2022		
Machine / type:	Hyundai HX380LC-9A	Hour reading:	7019
Serial No.:	131	Year:	2015
Inspector:	Chris	stick length:	3,10m
CE label <input checked="" type="checkbox"/>	boom check valve <input checked="" type="checkbox"/>	adjustable boom <input type="checkbox"/>	DPF <input checked="" type="checkbox"/> DEF (AdBlue) <input type="checkbox"/>
auto lube <input type="checkbox"/>	stick check valve <input type="checkbox"/>	stabilizer blade <input type="checkbox"/>	A/C <input checked="" type="checkbox"/>
lines hammer <input checked="" type="checkbox"/>	lines grapple/shear <input checked="" type="checkbox"/>	quick coupler type:	--
cab		cab door, covers	good
seat, arm rests	head rest missing	windows & mirrors	good
switches, joysticks	worn labels	wipers, washer	good
gauges & warn lights	good	floor mat	good
aircon / heater	good/good, one air vent broken	cab structure	guard bent
engine		Serial No.	
leaks & seals	no leaks seen	cooling system	dent in A/C cooler
oil condition & level	good	blow by	normal
exhaust, muffler	good	belts & filters	good
smoke	normal	coolant condition	low level
visual inspection exterior		covers / sheets	slight dents in belly
chassis, track frame	slight dents	side doors	good
engine hood	dent, corner cracked	compartments	good
steps, hand rails	steps bent slightly	bumpers / catwalk	good
boom	good	lights, batteries	good
stick	good	paintwork	good
hydraulics		boom cylinders	good
hoses,lines,swivel	some chafed	stick cylinder	good
pump and valve bloc	good	bucket cylinder	good
functional test		boom self drift	none
pins boom	moderate play	pump noises	normal
pins stick	moderate play	slew ring play	0,5mm
pins bucket	moderate play	electric system	good
swing drive/brake	good	drive train	good
tools		bucket 2, size,type	--
bucket 1, size & type	1,70m	condition	--
condition	new	coupler condition	--
U/C	remaining life mm (%)	rollers	50%
bushings	60%	track links	0%
shoes	70%	sprockets	30%
idlers	60%	track pitch in mm:	
carrier rollers	50%	shoe width in mm:	700mm
problems, details	Refill pump is not working.		
	The machine is in good condition. Some components on the undercarriage need to be replaced.		
dimensions for transport L x W x H in meter:			